


INSTALLATION OF BURMON-ICFWL TO ICF WALL

- 1** Flick a chalk line and mark the on-center spacing.

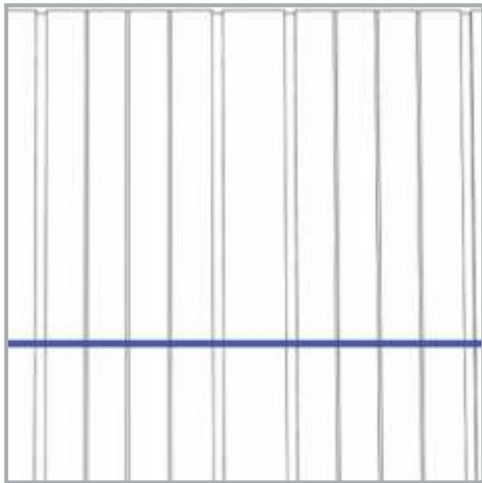


- 2** Using the BURMON-ICFWL Ledger Bracket as a template, mark the hole locations in the ICF wall.



- 3** Use the supplied spade point bit to drill $\frac{7}{8}$ -inch wide holes.



- 4** Insert the assembled BURMON-ICFWL flush to the face of the ICF wall.

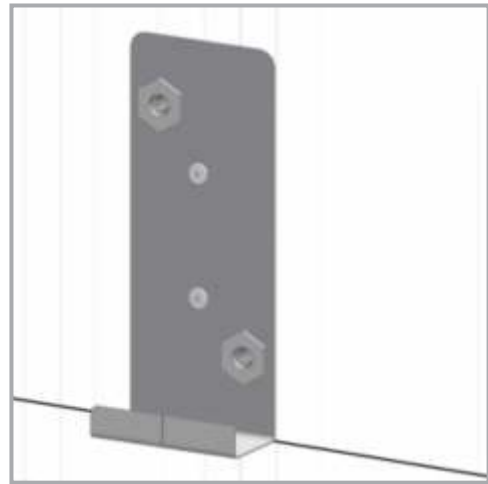

- 5** Place concrete (minimum f'c = 2500 psi)

Installation Tip: Use screws through holes in Ledger Bracket and into web to hold Burmon-ICFWL in place during concrete pour.



INSTALLATION OF WOOD LEDGER TO BURMON-ICFWL

- 1** After the concrete has cured and the ICF wall has settled, place the wood ledger inside the cradle of the BURMON-ICFWL on the ICF wall.




- 2** Check ledger bracket for correct height and level

Chalk line



- 3** Place the Bolt Hole Template into the ledger cradle and slip into slots provided.

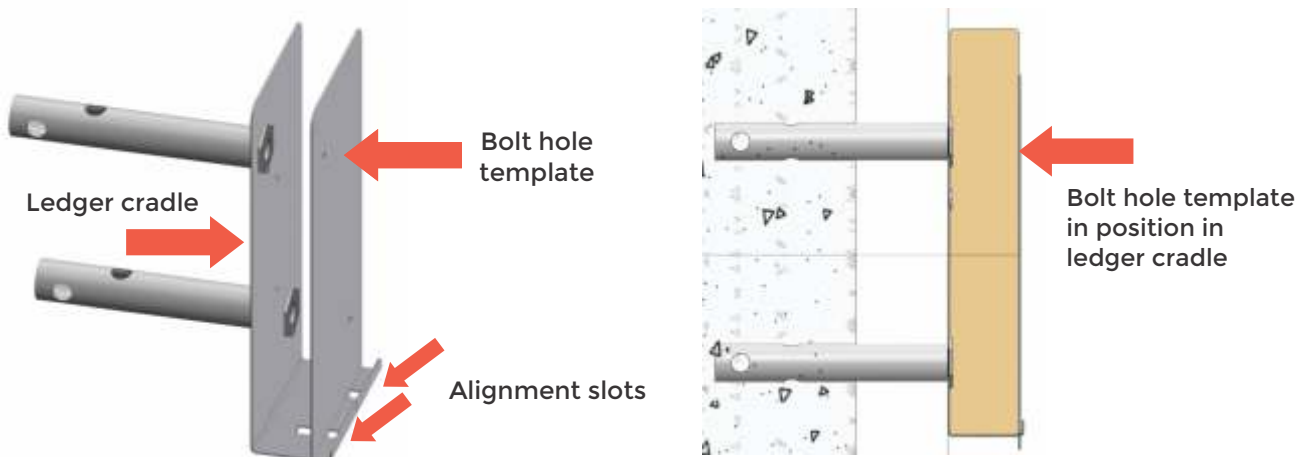


IMPORTANT NOTE: For drilling the holes in the wood ledger, use a **hole depth guide** so not to damage the threads of the cylinder bolt hole.




4 Drill pilot holes with a 13/64" drill bit.

 13/64" drill bit

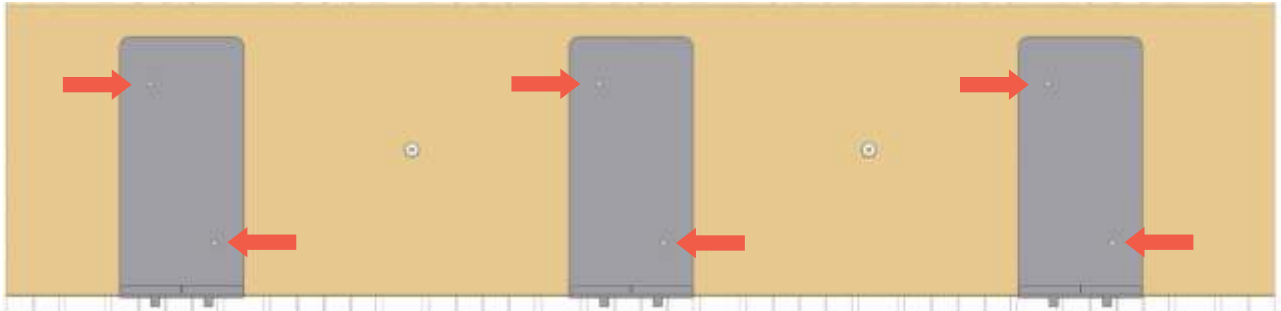

5 Enlarge pilot holes using a 9/16" drill bit.

 9/16" drill bit

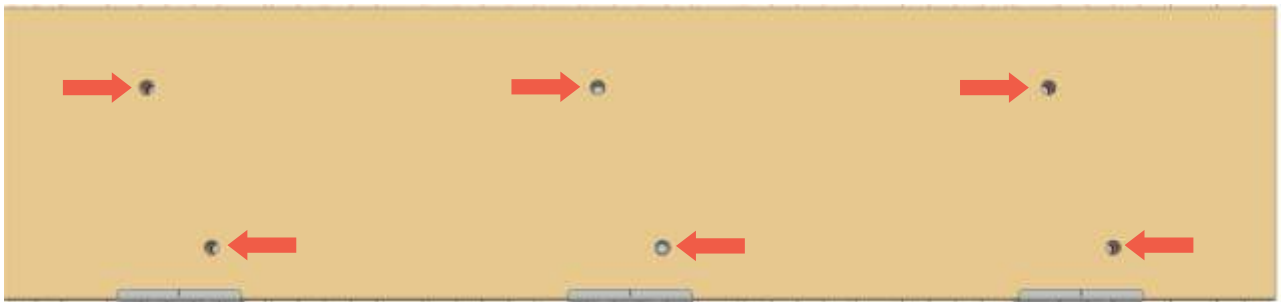

6 Bolt the ledger board to the **BURMON-ICFWL** using the Hex Head bolts and washers supplied. Tighten securely.

